

CASH SETTLED CLAIM(S)

The following information contains documents relating to claim(s) that were cash settled for the property.

If you require sign off or repair completion documents, they may be obtainable from the contractors who completed the substantive repairs at the property.

Version 2



Statement of Claim Checklist / Repair Strategy

CIM/2010/101940

Date: 15.12.10

Author: Peter Tully

Tohe Wanaa

13a BRYNLEY STREET

HORNBY

CHRISTCHURCH

LA: Peter Tully

Estimator: Charles Thomas

Room	Earthquake Damage	Walls	Ceiling	Floor	Repair Strategy
	Y/N	✓	✓	✓	
Lounge	Y	-	✓	-	PLASTER JOINTS CEILING - RAKE PLASTER + PAINT STIPPLE
Dining Room	N/A	-	-	-	
Kitchen Dining	N	-	-	-	Paint
SUN Family Room	Y	-	✓	✓	ALUMINIUM JOINTS DISPLACED - RE FIX CRACKED GROUND SLAG - GRIND + EPOXY
Bedroom 1	Y	-	✓	-	WATER DAMAGE TO STIPPLE CEILING - STRIP + RE STIPPLE
Ensuite	N/A	-	-	-	
Bedroom 2	N	-	-	-	
Bedroom 3	N/A	-	-	-	

5/27

2010/101940

Affix label here

SOC / Repair Strategy - Page 2

Version 2

Room	Earthquake Damage	Walls	Ceiling	Floor	Repair Strategy
	Y/N	✓	✓	✓	
Bedroom 4	N/A	—	—	—	
Bathroom	N	—	—	—	
Toilet 1	N	—	—	—	
Toilet 2	N/A	—	—	—	
Office / Study	N/A	—	—	—	
Rumpus	N/A	—	—	—	
Entry / Hall(s)	N	—	—	—	
Stairwell	N/A	—	—	—	
Laundry	N/A	—	—	—	
Garage	Y	—	✓	—	CEILING FROTHING DISPLACED - RE FIX
Pantry Other	Y	✓	—	—	CRACKS PAINT OPEN JOINTS - SCRAPE CLEAN AND PAINT

Initials)

5/1/10

2010/101940

Affix label here

SOC / Repair Strategy – Page 3

Version 2

Item		Event Damage Y / N	Repair Strategy
Roof		N	
EXTERNAL WALLS	North	Y	MORTAR CRACKS - RANK + RE POINT
	South	N	
	East	N	
	West	N	
Decks		N/A	
CHIMNEY	Base	N/A	
	Ceiling Cavity	N/A	
	Above Roof	N/A	
	Fireplace	N/A	

SAR 7

2010/101940

Affix label here

SOC / Repair Strategy – Page 4

Version 2

Item	Event Damage	Repair Strategy
	Y / N	
Foundations	N	
Piling	N/A	
Services	Y	POSSIBLE LEAK IN ROOF SPACE. REG CONTACT PLUMBER RE EMERGENCY REPAIR
Other Dwelling Items	N	
Outbuildings	N	
Land & Retaining Walls (Discuss with Supervisor)	N	

Supplementary Notes:

I confirm the rooms and areas listed above have been inspected by an EQC representative.

Damage caused by the event has been noted and to my knowledge there are no other areas of damage resulting from the event.

Signature of Claimant: [Signature] Dated: 15/12/10

NOTE: THIS FORM IS TO BE COMPLETED IN THE CLAIMANT'S PRESENCE.

Initials

3/12



Calculation Sheet

Version:

CLM/2010/101940

Tohe Waroa

13a BRYNLEY STREET

HORNBY

CHRISTCHURCH

Date: 21/12/10

Author: RICHARD LITTLEWOOD

LA: PETER TOLLY

Estimator: CHARLES THOMAS

Room	Repair Strategy	Units	Length	Breadth	Depth	Quantity	Rate	Cost
Lounge	STIPPLE CEILING	m ²	5	3.3		16.5	50	825
Dining Room								
Kitchen								
SUN Family Room	LABOUR - BRICKLAYER	Hr				4	50	200
	MATERIAL - EPOXY	EA				1	50	50
	LABOUR - CARPENTER	Hr				2	45	90
Bedroom 1	STIPPLE CEILING	m ²	4.3	3.6		15.48	50	774
Ensuite								
Bedroom 2								
Bedroom 3								

APPROVED

Sub total (Page 1) 1939

Affix label here

Calculation Sheet - Page 2

Room	Repair Strategy	Units	Length	Breadth	Depth	Quantity	Rate	Cost
Bedroom 4								
Bathroom								
Toilet 1								
Toilet 2								
Office / Study								
Rumpus								
Entry / Hall(s)								
Stairwell								
PANTRY	LABOUR - PAINTER	H-				2	45	90
	MATERIAL - FINISH, FILL	EA				1	30	30
Garage	LABOUR - CARPENTER	H-				2	45	90
	MATERIAL	EA				1	30	30

Sub total (Page 2) 240 ✓

APPROVED

Affix label here

Calculation Sheet -- Page 3

Room		Repair Strategy	Units	Length	Breadth	Depth	Quantity	Rate	Cost
Roof									
EXTERNAL WALLS	North	LABOUR - BRICKLAYER MATERIAL - MORTAR	1/2 EA				4 1	50 40	200 40
	South								
	East								
	West								
Decks									
CHIMNEY	Base								
	Ceiling Cavity								
	Above Roof								
	Fireplace								

Sub total (Page 3)

240 ✓

APPROVED

Calculation Sheet - Page 4

Affix label here

Room	Repair Strategy	Units	Length	Breadth	Depth	Quantity	Rate	Cost
Foundations								
Piling								
Services	TABBOUR - PLUMBER (inspect)	11				2	60	120
Other Dwelling Items								
Out-buildings								
Land and Retaining Walls								

APPROVED

Sub-total - Page 4 120 ✓

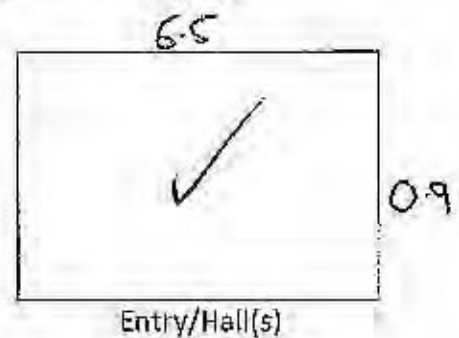
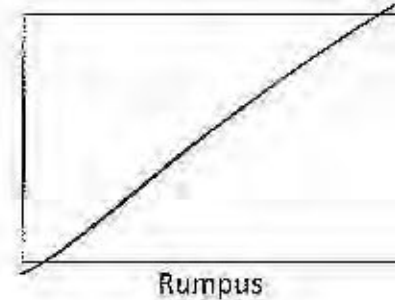
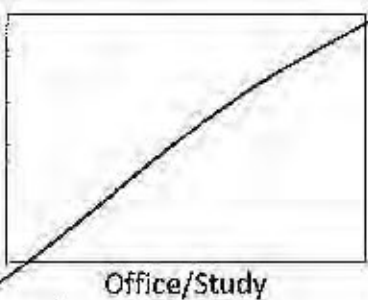
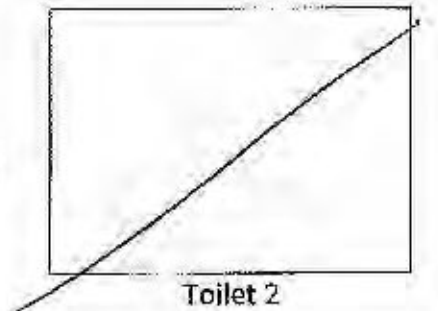
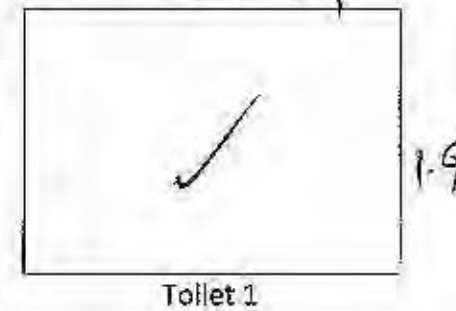
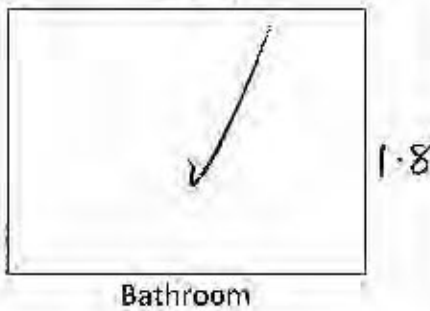
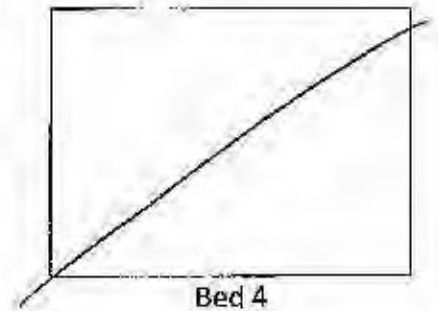
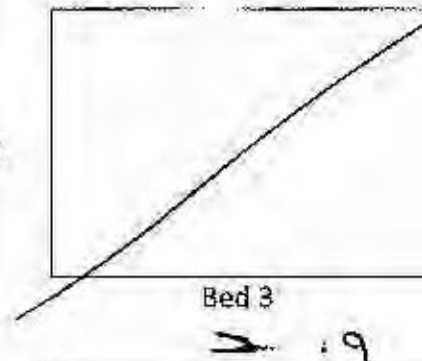
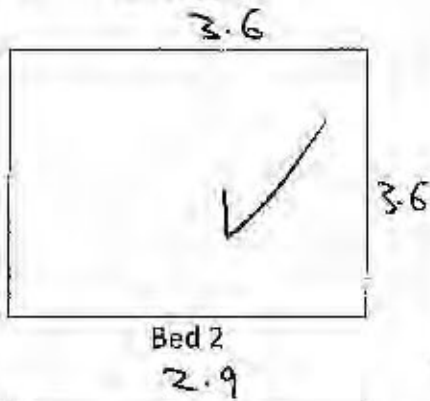
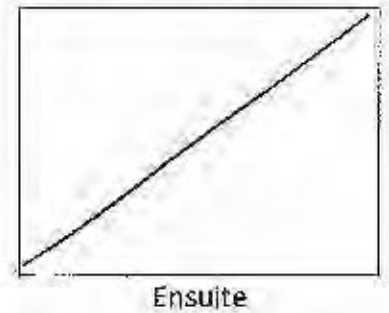
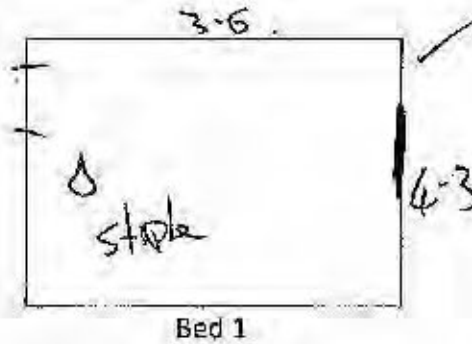
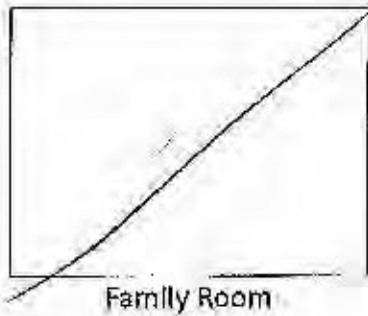
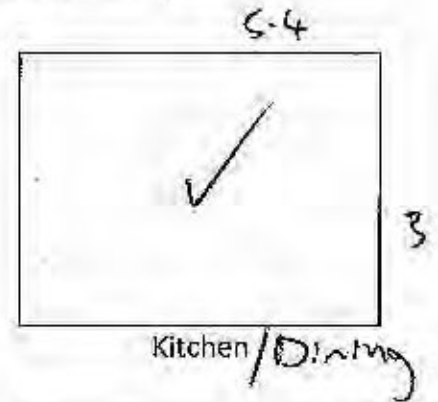
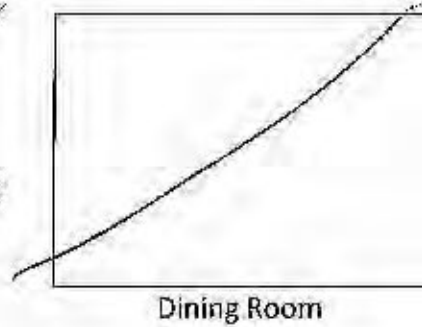
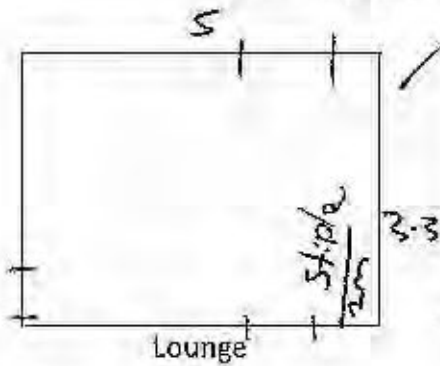
	Sub total - Page 1:	1930
	Page 2:	240 ✓
	Page 3:	240 ✓
	Page 4:	120 ✓
	+ P&G, Margin & GST Figure:	939-00
	APPROVED TOTAL:	\$3468-78

SUBTOTAL
\$2539

Date: 15.12.10









Claim Number: 2010/101940

Estimators Name: Charles Thomas

Dwelling Inspection Checklist: Show measurements indicate damage


Claim Number: 2010/101940

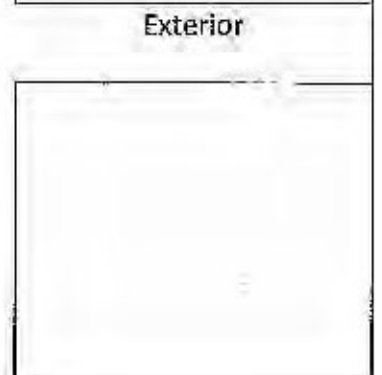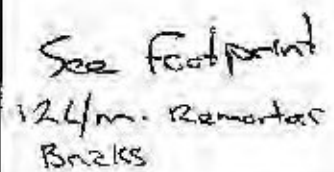Charles Thomas



Legend

—	Crack to ceiling (show length)
W	Crack to wall (show length)
X	External damage
O	Foundation damage
+	Floor damage

 Ceiling framing displaced

* Aluminium soiney
disphed

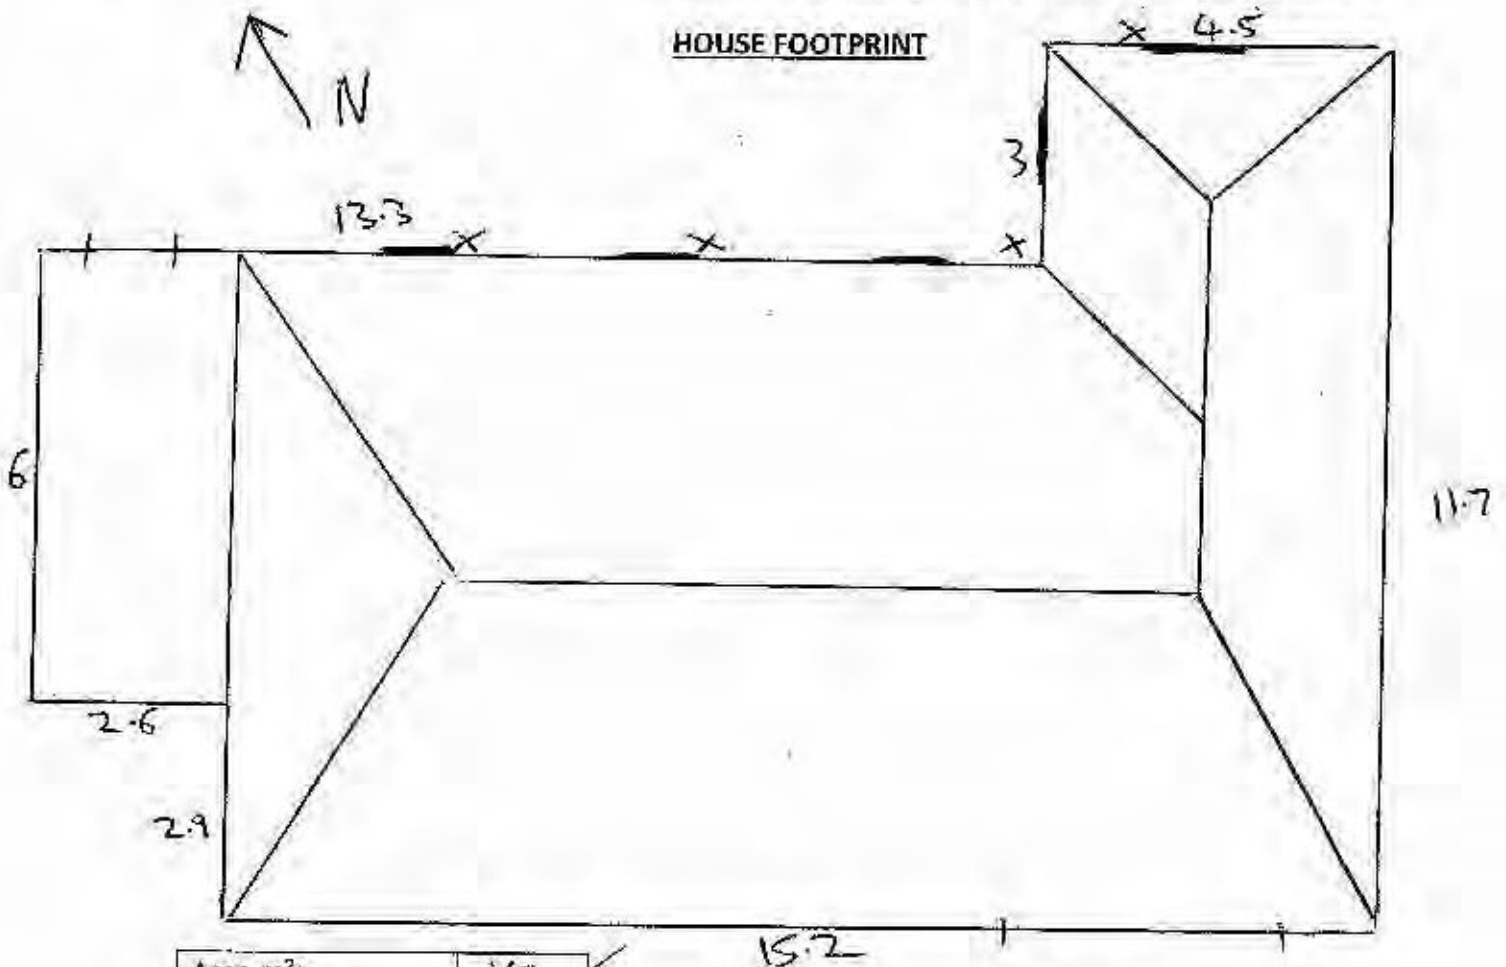
Water damage

Date: 15-12-10

Claim Number: 2010/101940

Estimators Name: Charles Thomas

HOUSE FOOTPRINT



Area m ² :	160
Stud Heights:	2.4
Wall Finish:	Wallpaper <u>Plastered</u> <u>Paint finish</u>
Other	
Services:	Specify damage: leak in roof - unclear where leak is coming from - plumber req
Chimneys: N=1	Construction type: Height: Damage description: Above Roof Below Roof Total Repair
Foundations Damage: Nil	Timber Concrete Ring <u>Concrete Slab</u> Other (Specify): Minor Moderate Severe House moved off foundations?: No Concrete slab cracked? Crack width: Crack length:
Roof:	Framed <u>Trussed</u> Type: Clay Tiles Concrete tiles Metal tiles <u>Rolled Metal</u> Other Damage:
Cladding Type:	Weatherboard Brick Veneer Hardiplank <u>Other Stone Veneer</u>

Scope of Works



Customer: AVRYLL SIXTUS

Document explanatory note:

This document provides a summary of the earthquake damage identified by the EQC assessment team. Land, building and room by room damage is listed along with an indication of how this damage is to be repaired. A glossary of terms describing the type of damage that may be listed on your Scope of Works is provided at the end of this document.

Assessment of Property at 13A BRYNLEY STREET, HORNBY, CHRISTCHURCH 8042 on 8/11/2011

Site

Element	Damage	Repair
Land (Exposed - Soil - 483.00 m2)		
Land (Under dwelling - Soil - 160.00 m2)		
Main Access (Drive - Concrete - 67.50 m2)	Uneven surface	Uplift and Reuse Pavers 67.50 m2

Services

Element	Damage	Repair
Sewerage (Town Connection - Clay pipes - 37.00 l/m)	No Earthquake Damage	
Water Supply (Town Connection - Steel - 37.00 l/m)	No Earthquake Damage	

Main Building

Exterior

Elevation (North 14.7 x 2.4 lime stone)

Element	Damage	Repair
No Damage		

Elevation (East 10.5 x 2.4 lime stone)

Element	Damage	Repair
No Damage		

Elevation (South 14.7 x 2.4 lime stone)

Element	Damage	Repair
No Damage		

Elevation (West 10.5 x 2.4 lime stone)

Element	Damage	Repair
Wall Cladding (Brick Veneer - Oamaru Stone - 25.20 m2)	Cracking	Grind out and repoint mortar 2.40 l/m
Wall framing (Timber Frame - Timber - 25.20 m2)	No Earthquake Damage	

Foundations (14.7 x 10.5 concrete slab)

Element	Damage	Repair
No Damage		

Roof (15.7 x 11.5 long run iron)

Element	Damage	Repair
No Damage		

Interior**Ground Floor - Lounge**

Room Size: 4.60 x 4.00 = 18.40 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
No Damage		

Ground Floor - Toilet

Room Size: 0.90 x 1.90 = 1.71 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
No Damage		

Ground Floor - Bathroom

Room Size: 1.80 x 3.10 = 5.58 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
Bath (Steel - Standard specification - 1.00 item)	No Earthquake Damage	
Bathroom Sink (Basin - Standard specification - 1.00 item)	No Earthquake Damage	
Ceiling (Gib - Paint - 5.58 m2)	Cosmetic Damage	Rake out, plaster and paint 5.58 m2
Door (Internal) (Single Hollow Core - Timber - 1.00 No of)	No Earthquake Damage	
Floor (Concrete - Vinyl - 5.58 m2)	No Earthquake Damage	
Shower (Cubical shower unit - Base stainless - 1.00 m2)	No Earthquake Damage	
Wall covering (Gib - Wallpaper - 23.52 m2)	No Earthquake Damage	
Window (Aluminium Awning - Pane single glazed - 1.00 No of)	No Earthquake Damage	

Ground Floor - Kitchen (Dining)

Room Size: 5.40 x 3.80 = 20.52 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
No Damage		

Ground Floor - Hallway

Room Size: 0.90 x 8.20 = 7.38 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
No Damage		

Ground Floor - Bedroom (Master)

Room Size: 4.50 x 3.70 = 16.65 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
---------	--------	--------

No Damage

Ground Floor - Internal Garage (Laundry)

Room Size: 8.30 x 4.00 = 33.20 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
---------	--------	--------

No Damage

Ground Floor - Bedroom (Next to toilet)

Room Size: 3.70 x 3.70 = 13.69 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
---------	--------	--------

No Damage

Ground Floor - Office/Study (Eg the garden room)

Room Size: 4.00 x 3.00 = 12.00 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
---------	--------	--------

No Damage

Ground Floor - Conservatory

Room Size: 5.80 x 2.60 = 15.08 (length(m) x width(m) = Area Size(m2))

Stud Height: 2.40 m

Element	Damage	Repair
---------	--------	--------

Ceiling (Other - Glass - 15.08 m2)	Cosmetic Damage	Refit metal frame
Conservatory (Aluminium - Glass - 40.32 m2)	No Earthquake Damage	
Door (External) (Sliding / Ranch sliding door - Timber - 2.00 No of)	Cosmetic damage	Realign 1.00 No of
Door (Internal) (Single sliding - Aluminium - 1.00 No of)	No Earthquake Damage	
Floor (Concrete - Carpet - 15.08 m2)	No Earthquake Damage	
Wall framing (Aluminium - Glass - 40.32 m2)	No Earthquake Damage	

Scope of Works - Glossary of Terms

Cosmetic Damage	Cosmetic damage is used to record repairs to an element that can be done in situ e.g. minor cracking to plasterboard. For example a repair strategy may state "rake, stop and paint" and this is carried out without needing to remove or replace the damaged element. Where the plasterboard for example needs to be removed and replaced, this will be recorded as 'structural damage'.
Impact Damage	Impact damage is where an element or part of a building sustains earthquake damage and then breaks away or collapses causing damage to another part of the building. An example is a chimney that has collapsed and caused damage to roof tiles.
Structural Damage	The term structural damage is used where a repair requires an element to be removed and replaced e.g. major cracking to plasterboard or external cladding that has been dislodged. This term does not relate to the structural integrity of the building as a whole, but to the individual element only.

Additional Information

Building Terms	The Department of Building and Housing website has a comprehensive list of common building terms: http://www.dbh.govt.nz/building-az-wxyz
-----------------------	---

EQC Full Assessment Report

Claim Number: CLM/2011/230379
Claimant: AVRYLL SIXTUS
Property Address: 13A BRYNLEY STREET
 HORNBY
 CHRISTCHURCH 8042

Assessment Date: 08/11/2011 16:43
Assessor: Campbell, David
Estimator: donnell, terry
Property Occupied By: Owner Occupied

Claimant Setup

Type	Name	Home Number	Mobile Number	Work Number	Email Address
Owner	AVRYLL, SIXTUS				

Insurance & Mortgage Details

Insurance Details - From Claim Centre

Insurer	Policy Type	Policy Number	Insurance Sighted	Insurance Valid
IAG - BNZ Bank Insurance Scheme	Dwelling		Yes	

Insurance Details - Added in COMET

Insurer	Policy Type	Policy Number	Insurance Sighted	Insurance Valid
---------	-------------	---------------	-------------------	-----------------

Insurance Details - Comments

Mortgage Details - From Claim Centre

Bank

Mortgage Details - Added in COMET

Bank

BANK OF NEW ZEALAND

Mortgage Details - Comments

Opt Out

For repairs costing between \$10,000 and \$100,000 the claimant wishes to manage their own repairs? No

Hazards

Hazards: Nil
Property Sticker: No Sticker

Building Configurations

Leaky Home Syndrome? No

Building Name	Number of floors	Building Finish	Age of house	Footprint	Area (m2)
Main Building	1	Standard	Post 1980	Rectangular	148.13

Full Assessment

Site

Element	Type	Material	Damages	Measure	Rate	Cost
Land	Exposed	Soil	No Earthquake Damage			
Land	Under dwelling	Soil	No Earthquake Damage			
Main Access	Drive	Concrete	Uneven surface			
			Uplift and Reuse Pavers	67.50 m2	70.00	4,725.00

General Comments:

Services

Element	Type	Material	Damages	Measure	Rate	Cost
Sewerage	Town Connection	Clay pipes	No Earthquake Damage			
Water Supply	Town Connection	Steel	No Earthquake Damage			

General Comments:

Main Building

Exterior

Elevation (North 14.7 x 2.4 lime stone)

Damage: No damage

Require Scaffolding? No

General Comments:

Elevation (East 10.5 x 2.4 lime stone)

Damage: No damage

Require Scaffolding? No

General Comments:

Elevation (South 14.7 x 2.4 lime stone)

Damage: No damage

Require Scaffolding? No

General Comments:

Elevation (West 10.5 x 2.4 lime stone)

Damage: Earthquake damage

Require Scaffolding? No

Element	Type	Material	Damages	Measure	Rate	Cost
Wall Cladding	Brick Veneer	Oamaru Stone	Cracking			
			Grind out and repoint mortar	2.40 l/m	30.00	72.00

Wall framing Timber Frame Timber No Earthquake Damage

General Comments: Ali glazed framed conservatory

Foundations (14.7 x 10.5 concrete slab)

Damage: No damage

Require Scaffolding? No

General Comments:

Roof (15.7 x 11.5 long run iron)

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Lounge

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Toilet

Damage: No damage

Require Scaffolding? No

General Comments: Stippled gib ceiling ,...painted wallpaper over gib walls ,...vinyl over concrete floor ,...1 Ali framed window ,...1 hollow core timber door ,...standard toilet

Ground Floor - Bathroom

Damage: Earthquake damage

Require Scaffolding? No

Element	Type	Material	Damages	Measure	Rate	Cost
Bath	Steel	Standard specification	No Earthquake Damage			
Bathroom Sink	Basin	Standard specification	No Earthquake Damage			
Ceiling	Gib	Paint	Cosmetic Damage			
			Rake out, plaster and paint	5.58 m2	27.00	150.66
Door (Internal)	Single Hollow Core	Timber	No Earthquake Damage			
Floor	Concrete	Vinyl	No Earthquake Damage			
Shower	Cubical shower unit	Base stainless	No Earthquake Damage			
Wall covering	Gib	Wallpaper	No Earthquake Damage			
Window	Aluminium Awning	Pane single glazed	No Earthquake Damage			

General Comments:

Ground Floor - Kitchen (Dining)

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Hallway

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Bedroom (Master)

Damage: No damage

Require Scaffolding? No

General Comments: Stippled gib ceiling ,...wallpapered gib walls ,...carpet over concrete floor ,...1 Ali framed window ,...1 hollow core timber door ,...

Ground Floor - Internal Garage (Laundry)

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Bedroom (Next to toilet)

Damage: No damage

Require Scaffolding? No

General Comments: stippled gib ceiling ,...wallpaper over gib walls ,...carpet over concrete floor ,...1 Ali framed window ,...1 hollow core timber door ,...

Ground Floor - Office/Study (Eg the garden room)

Damage: No damage

Require Scaffolding? No

General Comments:

Ground Floor - Conservatory

Damage: Earthquake damage

Require Scaffolding? No

Element	Type	Material	Damages	Measure	Rate	Cost
Ceiling	Other	Glass	Cosmetic Damage			
			Refit metal frame	500.00 \$	0.00	500.00
Conservatory	Aluminium	Glass	No Earthquake Damage			
Door (External)	Sliding / Ranch sliding door	Timber	Cosmetic damage			
			Realign	1.00 No of	90.00	90.00

Door (Internal)	Single sliding	Aluminium	No Earthquake Damage
Floor	Concrete	Carpet	No Earthquake Damage
Wall framing	Aluminium	Glass	No Earthquake Damage

General Comments:

Fees

Fees

Name	Duration	Estimate
------	----------	----------

Overheads

Name	Estimate
Preliminary and general	443.01
Margin	598.07
GST	986.81

Scope Of Works Estimate

Property

Description	Estimate
Site	4,725.00
Services	0.00
	4,725.00

Main Building

Name	Description	Estimate
Exterior	Foundations (14.7 x 10.5 concrete slab)	0.00
	Roof (15.7 x 11.5 long run iron)	0.00
	Elevation (East 10.5 x 2.4 lime stone)	0.00
	Elevation (North 14.7 x 2.4 lime stone)	0.00
	Elevation (South 14.7 x 2.4 lime stone)	0.00
	Elevation (West 10.5 x 2.4 lime stone)	72.00
		72.00

Floor	Description	Estimate
Ground Floor	Bathroom	150.66
	Bedroom (Master)	0.00
	Bedroom (Next to toilet)	0.00
	Conservatory	590.00
	Hallway	0.00
	Internal Garage (Laundry)	0.00
	Kitchen (Dining)	0.00
	Lounge	0.00
	Office/Study (Eg the garden room)	0.00
	Toilet	0.00
		740.66
		740.66

Fees

Description	Estimate
-------------	----------

Overheads

Description	Estimate
Preliminary and general	443.01
Margin	598.07
GST	986.81
	2,027.89
Total Estimate	7,565.55

Inspection Sign Off

Description	Answer	comments
Contents Damage		
Has the contents schedule been left with claimant?	No	
Have the contents been sighted?	No	
Land Damage		
Is there land damage?	Yes	Uneven under driveway
Landslip damage has been assessed on paper	No	
Was a full inspection done?		
In roof space	Yes	
On roof?	Yes	
Under sub floor?	No	Concrete slab floor
Decline Claim		
Recommend Declining Claim	No	
Next Action:		

Previous Claim Numbers (recorded manually in field)

- Nil

File Notes

Date Created: 08/11/2011 16:08

Created : Campbell, David

Subject: General info

Note: Dwelling built 1991 ,...long run iron roof ,...Oamaru stone exterior cladding ,...concrete slab floor ,...minor cracking to exterior wall cladding ,...cosmetic damage to interior wall and ceiling linings ,...dwelling is habitable and watertight .this proerty purchased by customer in 3/11all damage now inspected relates to damage which occurred after that date .

Next Action:

Urgent Works Items

REMEDIAL DOCUMENTATION

The following documentation contains information relating to remedial claims against this property.

Remedial claims refer to concerns raised by homeowners following the settlement of their original Canterbury claim(s).

- NHC Toka Tū Ake settlement did not include all earthquake damage
- NHC Toka Tū Ake repair work or repair strategy hasn't or won't repair the earthquake damage to the standard required by the EQC Act
- NHC Toka Tū Ake wasn't or isn't sufficient to meet the reasonable costs of undertaking NHC Toka Tū Ake repair strategy

Matt Buckland**INVOICE**INVOICE 1917
DATE: 09.09.17**TO:**Avryll Sixtus
13A Brynley St
Christchurch**SHIP TO:****COMMENTS OR SPECIAL INSTRUCTIONS:**

SALESPERSON	P.O. NUMBER	REQUISITIONER	SHIPPED VIA	F.O.B. POINT	TERMS
					Due on receipt

QUANTITY	DESCRIPTION	UNIT PRICE	TOTAL
	Repair to brickwork as follows		
	Grind, epoxy, repoint staircase cracking under windows		
	Pull 3 courses off 2x panels and relay to soffit		
	Replace 2x window sills		
	Pull down internal corner at rear garage door to half height, relay		
	and repoint with extra ties for support and relay the sill		

SUBTOTAL	
SALES TAX	Incl.
SHIPPING & HANDLING	
TOTAL DUE	\$1,550.00

Payment by cheque

Invoice

O'Sullivan Contracting and ChCh Sunrooms
 7 Berkeley Close
 Rangiora 7400

0274415613
 chchsunrooms@yahoo.co.nz

Invoice No: 827
 Date: 27 July 2016
 Terms: NET 7
 Due Date: 3 August 2016



GST Reg N°: 70-809-443

Bill To: Avryll
 13a Brynley St
 [REDACTED]

Description	Quantity	Rate	Amount
Fixed price quote to remove damage d conservatory roof and replace with new 50mm thermo roof without glass section and remove and dump or recycle old roof	1	\$2,822.00	\$2,822.00

* Indicates non-taxable item

Please note on acceptance of this quote you as the purchaser undertake to pay this account in full within 14 days (of our completion of the job)

Should you require terms an extra percentage charge will apply.

payment to ANZ 0108220110401-00

Subtotal	\$2,822.00
GST (15.00%)	\$423.30
Total	\$3,245.30
Paid	\$0.00
Balance Due	\$3,245.30

Please detach and send with remittance to:

O'Sullivan Contracting and ChCh Sunrooms
 7 Berkeley Close
 Rangiora 7400

REMITTANCE ADVICE FOR Invoice # 827 on 27 Jul 2016

Balance Due: \$3,245.30

Amount Paid: _____

Received From: Avryll



QUOTE

Avryll Sixtus

2011/230379

Date
10 May 2018

Expiry
09 Jun 2018

Account Number

Quote Number
QU-0019

Reference
If no Asbestos

GST Number
070-341-948

Worthingtons
Construction Limited
5 Harmony Lane
Woolston
Christchurch 8062
NEW ZEALAND

Repair Earthquake damage to Dining, Lounge, and Kitchen ceilings at 13A Brynley Street, Hornby

Stipple ceiling in open plan Lounge, Dining, and Kitchen area has been damaged in earthquake and requires re plastering total square metres 38

Description	Quantity	Unit Price	GST	Amount NZD
Asbestos test to stipple ceiling	1.00	220.00	15%	220.00
Floor protection	1.00	200.00	15%	200.00
Furniture and fittings protection	1.00	250.00	15%	250.00
Electrician remove and refit lights	1.00	145.00	15%	145.00
remove stipple and plaster make good	38.00	53.70	15%	2,040.60
paint ceiling	38.00	25.00	15%	950.00
			Subtotal	3,805.60
			Total GST 15%	570.84
			TOTAL NZD	4,376.44

Terms



QUOTE

Avryll Sixtus

Date
10 May 2018

Expiry
09 Jun 2018

Account Number

Worthingtons
Construction Limited
5 Harmony Lane
Woolston
Christchurch 8062
NEW ZEALAND

Quote Number
QU-0020

Reference
If Asbestos in ceiling

GST Number
070-341-948

2011/230379

Repair Earthquake damage to Dining, Lounge, and Kitchen ceilings at 13A Brynley Street, Hornby

Stipple ceiling in open plan Lounge, Dining, and Kitchen area has been damaged in earthquake and requires re plastering total square metres 38

Description	Quantity	Unit Price	GST	Amount NZD
Asbestos test to stipple ceiling	1.00	220.00	15%	220.00
Floor protection	1.00	200.00	15%	200.00
Remove and store Furniture and fittings	1.00	600.00	15%	600.00
Electrician remove and refit lights	1.00	145.00	15%	145.00
remove asbestos stipple with air test before during and on completion	38.00	110.00	15%	4,180.00
Plaster and make good ceilings	38.00	40.00	15%	1,520.00
Paint ceiling	38.00	25.00	15%	950.00
Subtotal				7,815.00
Total GST 15%				1,172.25
TOTAL NZD				8,987.25

Terms